

issues

OPTIONAL BULLETIN No. BB/25b

- 1. WITH REFERENCE TO:** All hot air balloons of BB type incl. balloons with an special shaped envelope supplied with the KOMET DUO burners up to S/N 104.
- 2. REASON:** Tightness enhancement of the main flight and whisper valve.
- 3. REQUIRED ACTION:** Replacement of the front sealing No. 51133 and the screw No. 1116 (see Maintenance Manual No. B.0202 issued on 20.10.2001).
- 4. DEADLINE FOR ACTION:** It is recommended to replace the parts throughout the next annual inspection or routine maintenance of the flight / whisper valve whichever comes first.
- 5. ACTION CARRIED OUT:** Manufacturer / approved organization
- 6. INDUCED COST COVERED:** Balloon operator
- 7. NECESSARY MATERIAL:** Sealing set, screws, Loctite 243 glue
- 8. PROCESS:**
- 1) Realize the disassembly of the main flight / whisper valve on both burner units in accordance with the Maintenance Manual (see Section 6, procedure No. 31-11 / 35-11).
 - 2) Remove the screw 1116 and the sealing 51133.
 - 3) Clean the front area of the stem No. 51118 properly.
 - 4) Insert the new sealing. Apply small drop of the Loctite 243 glue to the thread tip of the new screw before screwing.
- 9. BULLETIN TAKES EFFECT:** From the date of the CAA, Czech Republic approval
- 10. ENCLOSURES:** None

On behalf of the manufacturer:

Ing. Josef Pučégl



Date: 28. 4. 2003