

Issues

SERVIS BULLETIN No. BB/52

- 1. WITH REFERENCE TO:** Hot-air balloons Kubicek (serial numbers: 1292, 1331, 1360, 1364, 1397)
- 2. REASON:** Possible occurrence of a weaving defect on a load tape
- 3. REQUIRED ACTION:** Checking up all the load tapes (White PES Tape 20 kN, width 25 mm, thickness 2,7mm, lined with black threads by sides)
- 4. DEADLINE FOR ACTION:** August 31, 2018
- 5. ACTION CARRIED OUT BY:** Maintenance organization authorized by national regulations
- 6. INDUCED COST COVERED:** Owner/Operator
- 7. NECESSARY MATERIAL:** In case of replacement: 2782.01 – White PES Tape, width 25 - for balloons, 20 kN
- 8. PROCESS:** Check all the load tapes and in case of finding a yellow thread carry out a repair according to MM, Chap. 3.3.
- 9. BULLETIN TAKES EFFECT:** July 23, 2018
- 10. ENCLOSURES:** 1. Example of a weaving defect marking

Technical content of this document is approved under the authority of DOA No. EASA.21J.277

On behalf of BALÓNY KUBÍČEK spol. s r.o.:


Ing. Petr Kubíček, technical director

Date: 23 July 2018



Enclosure 1

Example of a yellow thread marking of a weaving defect

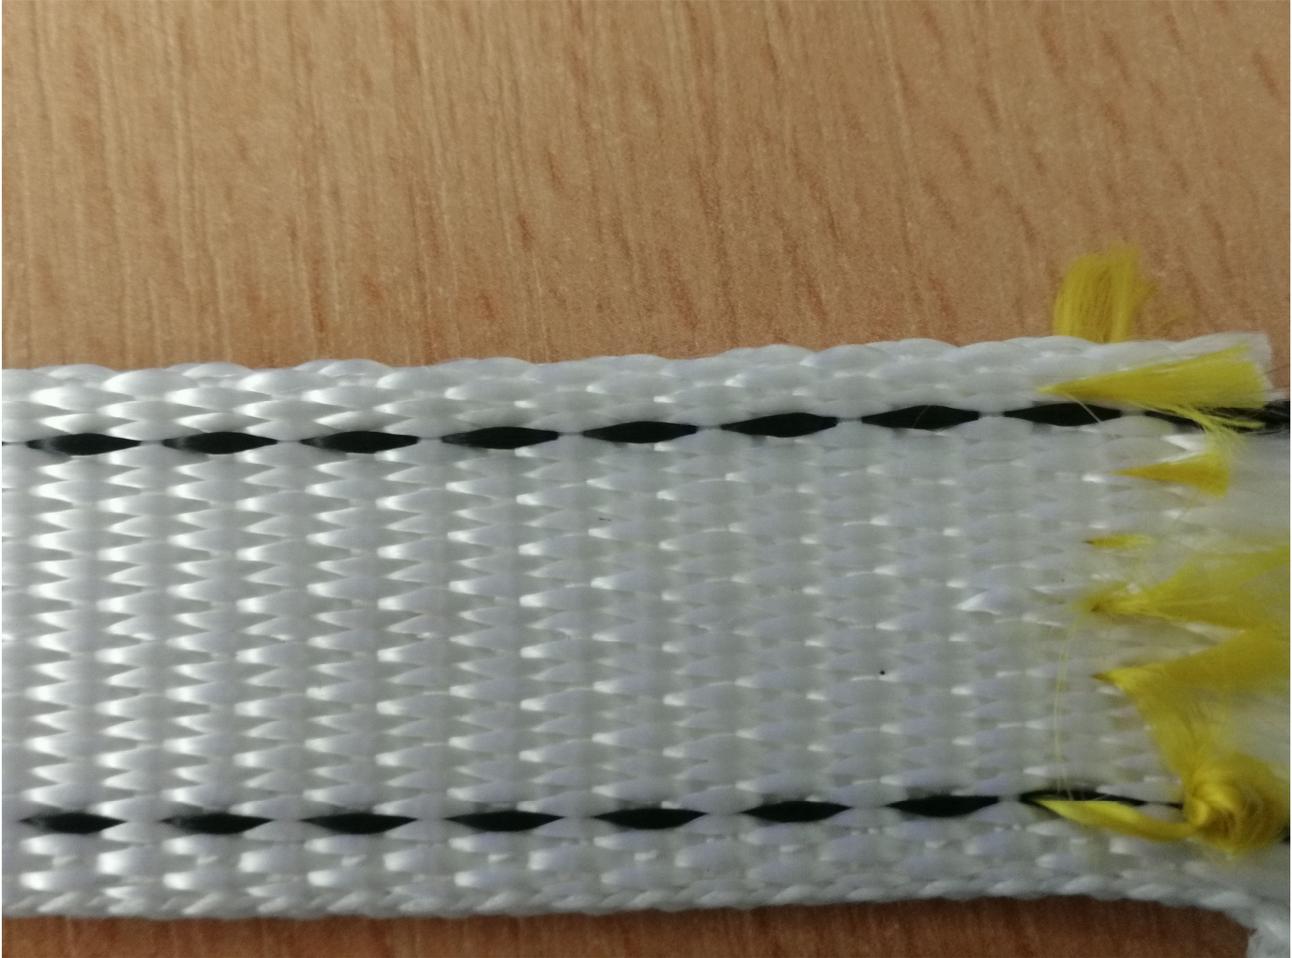

Note: The yellow thread is not necessarily visible this way – it will be probably more integrated into the weaving.